Dimensional Document


Viega PureFlow® Press

This document is subject to updates. For the most current Viega technical literature, please visit www.viega.us.

Viega products are designed to be installed by licensed and trained plumbing and mechanical professionals who are familiar with Viega products and their installation. **Installation by non–professionals may void Viega LLC's warranty.**


Zero Lead identifies Viega products meeting the lead free requirements of NSF/ANSI/CAN 61 through testing under NSF/ANSI/CAN 372 (0.25% or less maximum weighted average lead content).

PureFlow Press 90° Elbow Zero Lead Bronze – Model 2816ZL

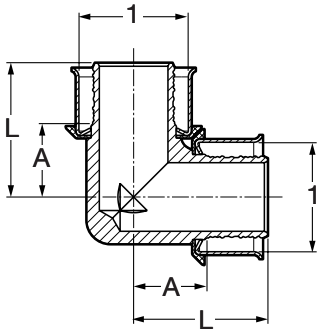


Part No.	Size (in)	A (in)		L (in)	
	1 1	Dec	Frac	Dec	Frac
93520	½ x ½	0.47	½	0.97	1
93540	¾ x ¾	0.59	9⁄16	1.09	1 1⁄16
93560	1 x 1	0.88	⅞	1.50	1½
93570	1¼ x 1¼	0.95	15⁄16	1.81	1 13⁄16
93580	1½ x 1½	1.14	1⅛	2.01	2 1⁄16
93590	2 x 2	1.33	1 5⁄16	2.38	2⅜

PureFlow Press 90° Elbow Polymer – Model V5616

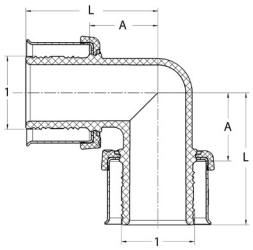


Part No.	Size (in)	A (in)		L (in)	
	1	Dec	Frac	Dec	Frac
49210	⅜	0.51	½	1.11	1⅛
49220	½	0.51	½	1.11	1⅛
49240	¾	0.68	11⁄16	1.27	1¼
49260	1	0.77	¾	1.52	1½
49270	1¼	0.98	1	2.08	2 1⁄16
49280	1½	1.09	1 1⁄16	2.19	2 3⁄16
49290	2	1.65	1⅝	2.72	2¾

PureFlow Press 45° Elbow Polymer – Model V5626

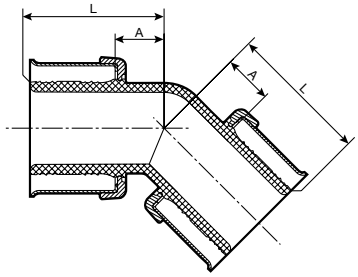


Part No.	Size (in)	A (in)		L (in)	
	1	Dec	Frac	Dec	Frac
49285	1½	0.66	11/16	1.75	1¾
49286	2	0.96	15/16	2.03	2 1/16

PureFlow Press 90° Elbow Zero Lead Bronze P x MPT – Model 2814ZL

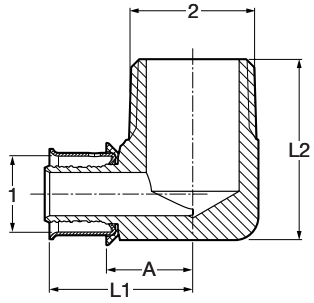


Part No.	Size (in)		A (in)		L1 (in)		L2 (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
92520	½	½ MPT	0.64	5/8	1.13	1⅛	1.06	1 1/16
92525	½	¾ MPT	0.74	¾	1.24	1¼	1.14	1⅛
92540	¾	¾ MPT	0.74	¾	1.24	1¼	1.13	1⅛
92545	¾	1 MPT	0.98	1	1.48	1½	1.61	1⅝
92560	1	1 MPT	0.98	1	1.60	1⅝	1.61	1⅝
92565	¾	1¼ MPT	1.32	1 5/16	1.81	1 13/16	1.67	1 11/16
92570	1	1¼ MPT	1.31	1 5/16	1.93	1 15/16	1.67	1 11/16
92757	1¼	1¼ MPT	1.32	1 5/16	2.19	2 3/16	1.67	1 11/16
92580	1½	1½ MPT	1.34	1 5/16	2.21	2 3/16	1.73	1¾

PureFlow Press 90° Elbow Zero Lead Bronze P x Copper – Model 2814.5ZL

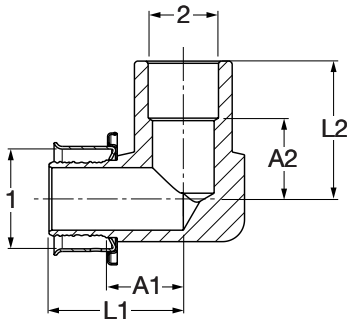


Part No.	Size (in)		A1 (in)		A2 (in)		L1 (in)		L2 (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
99308	½	¾	0.68	11/16	0.47	½	1.18	1 3/16	1.22	1¼
99309	¾	¾	0.68	11/16	0.47	½	1.18	1 3/16	1.22	1¼

PureFlow Press 90° Elbow Zero Lead Bronze P x FTG – Model 2814.6ZL

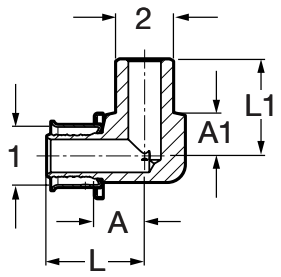


Part No.	Size (in)		A (in)		A1 (in)		L (in)		L1 (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
99310	½	½	0.58	9/16	0.47	½	1.07	1 1/16	1.06	1 1/16

PureFlow Press 90° Elbow Zero Lead Bronze P x Copper – Model 2814.7ZL

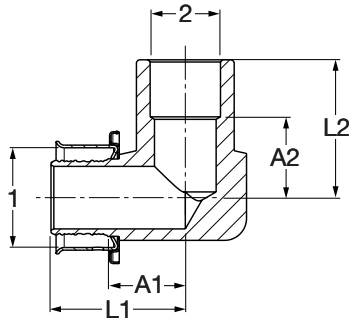


Part No.	Size (in)		A1 (in)		A2 (in)		L1 (in)		L2 (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
99307	½	½	0.71	11/16	0.72	¾	1.20	1 3/16	1.23	1¼
99311	¾	½	0.71	11/16	0.72	¾	1.20	1 3/16	1.23	1¼

PureFlow Press 90° Drop Ear Elbow Zero Lead Bronze – Model 2825.5ZL

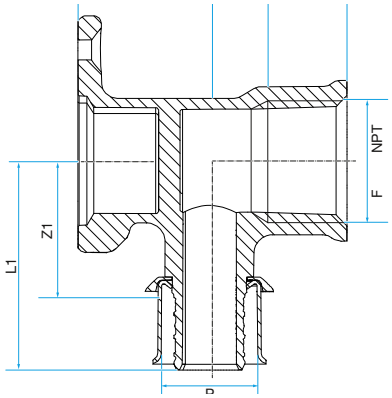


Part No.	Size (in)		A1 (in)		A2 (in)		L1 (in)		L2 (in)		L3 (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
94505	⅜	½	22.4	22⅜	11.4	11⅜	35	35	13.6	13⅝	22	22
94520	½	½	22.4	22⅜	11.4	11⅜	35	35	13.6	13⅝	22	22
94535	¾	½	22.4	22⅜	13.4	13⅜	35	35	13.6	13⅝	22	22
94540	¾	¾	22.4	22⅜	15.9	16	38	38	14.4	14⅜	22	22

PureFlow Press Tee Zero Lead Bronze P x P x P – Model 2818ZL

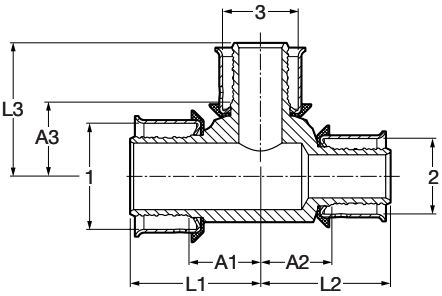

Part No.	Size (in)			A1 (in)		A2 (in)		A3 (in)		L1 (in)		L2 (in)		L3 (in)	
	1	2	3	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
94020	½	½	½	0.47	½	0.47	½	0.47	½	0.97	1	0.97	1	0.97	1
94022	½	½	¾	0.62	⅝	0.62	⅝	0.59	9/16	1.12	1⅛	1.12	1⅛	1.09	1 1/16
94040	¾	¾	¾	0.59	9/16	0.59	9/16	0.59	9/16	1.09	1 1/16	1.09	1 1/16	1.09	1 1/16
94032	¾	½	½	0.59	9/16	0.59	9/16	0.62	⅝	1.09	1 1/16	1.09	1 1/16	1.12	1⅛
94034	¾	½	¾	0.59	9/16	0.62	⅝	0.59	9/16	1.09	1 1/16	1.12	1⅛	1.09	1 1/16
94036	¾	¾	½	0.59	9/16	0.59	9/16	0.62	⅝	1.09	1 1/16	1.09	1 1/16	1.12	1⅛
94060	1	1	1	0.88	⅞	0.88	⅞	0.88	⅞	1.50	1½	1.50	1½	1.50	1½
94037	1	½	½	0.58	9/16	0.59	9/16	0.82	13/16	1.20	1 3/16	1.08	1 1/16	1.32	1 5/16
94039	1	½	1	0.76	¾	0.74	¾	0.76	¾	1.38	1⅜	1.24	1¼	1.38	1⅜
94038	1	¾	½	0.58	9/16	0.59	9/16	0.82	13/16	1.20	1 3/16	1.08	1 1/16	1.32	1 5/16
94052	1	¾	¾	0.80	13/16	0.76	¾	0.84	13/16	1.40	1⅜	1.26	1¼	1.34	1 5/16
94053	1	¾	1	0.76	¾	0.71	11/16	0.76	¾	1.38	1⅜	1.20	1 3/16	1.38	1⅜
94050	1	1	½	0.68	11/16	0.68	11/16	0.84	13/16	1.30	1 5/16	1.30	1 5/16	1.34	1 5/16
94056	1	1	¾	0.80	13/16	0.80	13/16	0.84	13/16	1.42	1 7/16	1.42	1 7/16	1.34	1 5/16
94070	1¼	1¼	1¼	1.00	1	1.00	1	1.00	1	1.87	1⅞	1.87	1⅞	1.87	1⅞
94071	1¼	1	¾	0.73	¾	0.74	¾	0.98	1	1.59	1 9/16	1.36	1⅜	1.48	1½
94073	1¼	1	1	0.81	13/16	0.82	13/16	0.99	1	1.67	1 11/16	1.44	1 7/16	1.61	1⅝
94072	1¼	1¼	¾	0.79	13/16	0.73	¾	0.99	1	1.59	1 9/16	1.59	1 9/16	1.48	1½


PureFlow Press Tee Polymer – Model V5618

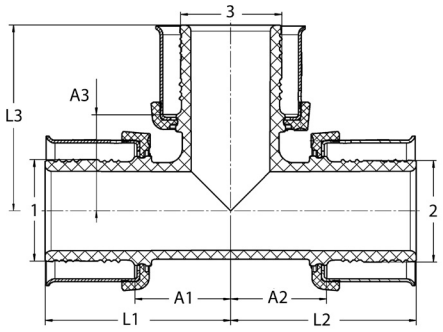

Part No.	Size (in)			A1 (in)		A2 (in)		A3 (in)		L1 (in)		L2 (in)		L3 (in)	
	1	2	3	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
49200	⅜	x ⅜	x ⅜	0.51	½	0.51	½	0.51	½	1.11	1⅛	1.11	1⅛	1.11	1⅛
49322	½	x ⅜	x ⅜	0.49	½	0.44	7⁄16	0.54	9⁄16	1.09	1 1⁄16	1.04	1 1⁄16	1.13	1⅛
49332	½	x ½	x ⅜	0.49	½	0.49	½	0.54	9⁄16	1.09	1 1⁄16	1.09	1 1⁄16	1.13	1⅛
49520	½	x ½	x ½	0.51	½	0.51	½	0.51	½	1.11	1⅛	1.11	1⅛	1.11	1⅛
49334	½	x ½	x ¾	0.67	11⁄16	0.67	11⁄16	0.60	5⁄8	1.26	1¾	1.26	1¾	1.19	1 3⁄16
49433	¾	x ½	x ½	0.59	9⁄16	0.49	½	0.69	11⁄16	1.18	1 3⁄16	1.09	1 1⁄16	1.28	1¼
49434	¾	x ½	x ¾	0.71	11⁄16	0.71	11⁄16	0.71	11⁄16	1.30	1 5⁄16	1.30	1 5⁄16	1.30	1 5⁄16
49443	¾	x ¾	x ½	0.59	9⁄16	0.59	9⁄16	0.69	11⁄16	1.18	1 3⁄16	1.18	1 3⁄16	1.28	1¼
49540	¾	x ¾	x ¾	0.71	11⁄16	0.71	11⁄16	0.71	11⁄16	1.30	1 5⁄16	1.30	1 5⁄16	1.30	1 5⁄16
49533	1	x ½	x ½	0.59	9⁄16	0.49	½	0.74	¾	1.34	1 5⁄16	1.09	1 1⁄16	1.34	1 5⁄16
49535	1	x ½	x 1	0.81	13⁄16	0.79	13⁄16	0.81	13⁄16	1.56	1 9⁄16	1.36	1⅜	1.56	1 9⁄16
49543	1	x ¾	x ½	0.60	5⁄8	0.59	9⁄16	0.74	¾	1.35	1⅜	1.18	1 3⁄16	1.34	1 5⁄16
49544	1	x ¾	x ¾	0.71	11⁄16	0.65	5⁄8	0.85	7⁄8	1.47	1½	1.25	1¾	1.44	1 7⁄16
49545	1	x ¾	x 1	0.84	13⁄16	0.77	¾	0.84	13⁄16	1.59	1 9⁄16	1.37	1⅜	1.59	1 9⁄16
49553	1	x 1	x ½	0.58	9⁄16	0.58	9⁄16	0.74	¾	1.34	1 5⁄16	1.34	1 5⁄16	1.34	1 9⁄16
49554	1	x 1	x ¾	0.71	11⁄16	0.71	11⁄16	0.84	13⁄16	1.47	1½	1.47	1½	1.44	1 7⁄16
49560	1	x 1	x 1	0.71	11⁄16	0.71	11⁄16	0.71	11⁄16	1.47	1½	1.47	1½	1.47	1½
49754	1¼	x 1	x ¾	0.73	¾	0.67	11⁄16	0.93	15⁄16	1.82	1 13⁄16	1.42	1 7⁄16	1.53	1½
49755	1¼	x 1	x 1	0.84	13⁄16	0.78	¾	0.91	15⁄16	1.94	1 15⁄16	1.53	1½	1.66	1 11⁄16
49888	1¼	x 1¼	x ½	0.60	5⁄8	0.60	5⁄8	0.93	15⁄16	1.69	1 11⁄16	1.69	1 11⁄16	1.53	1½
49774	1¼	x 1¼	x ¾	0.73	¾	0.73	¾	0.93	15⁄16	1.82	1 13⁄16	1.82	1 13⁄16	1.53	1½
49775	1¼	x 1¼	x 1	0.84	13⁄16	0.84	13⁄16	0.91	15⁄16	1.94	1 15⁄16	1.94	1 15⁄16	1.66	1 11⁄16
49570	1¼	x 1¼	x 1¼	0.98	1	0.98	1	0.98	1	2.07	2 1⁄16	2.07	2 1⁄16	2.07	2 1⁄16
49854	1½	x 1	x ¾	0.72	¾	0.79	13⁄16	1.03	1 1⁄16	1.82	1 13⁄16	1.54	1 9⁄16	1.63	1⅝
49855	1½	x 1	x 1	0.85	7⁄8	0.91	15⁄16	1.03	1 1⁄16	1.94	1 15⁄16	1.67	1 11⁄16	1.78	1¾
49886	1½	x 1	x 1½	0.99	1	1.00	1	1.09	1 1⁄16	2.08	2 1⁄16	1.74	1¾	2.18	2 3⁄16
49874	1½	x 1¼	x ¾	0.77	¾	0.77	¾	1.04	1 1⁄16	1.82	1 13⁄16	1.82	1 13⁄16	1.63	1⅝
49875	1½	x 1¼	x 1	0.90	7⁄8	0.90	7⁄8	1.06	1 1⁄16	1.94	1 15⁄16	1.94	1 15⁄16	1.79	1 13⁄16
49877	1½	x 1¼	x 1¼	1.02	1	1.02	1	1.11	1⅛	2.06	2 1⁄16	2.06	2 1⁄16	2.16	2 3⁄16
49883	1½	x 1½	x ½	0.72	¾	0.72	¾	1.03	1 1⁄16	1.81	1 13⁄16	1.81	1 13⁄16	1.60	1⅝
49884	1½	x 1½	x ¾	0.72	¾	0.72	¾	1.03	1 1⁄16	1.82	1 13⁄16	1.82	1 13⁄16	1.60	1⅝
49885	1½	x 1½	x 1	0.85	7⁄8	0.85	7⁄8	1.04	1 1⁄16	1.94	1 15⁄16	1.94	1 15⁄16	1.78	1¾
49887	1½	x 1½	x 1¼	0.97	1	0.97	1	1.07	1 1⁄16	2.06	2 1⁄16	2.06	2 1⁄16	2.15	2⅛
49580	1½	x 1½	x 1½	1.09	1 1⁄16	1.09	1 1⁄16	1.09	1 1⁄16	2.18	2 3⁄16	2.18	2 3⁄16	2.18	2 3⁄16
49984	2	x 1½	x ¾	1.07	1 1⁄16	1.10	1⅛	1.42	1 7⁄16	2.14	2⅛	2.15	2⅛	1.99	2
49985	2	x 1½	x 1	1.07	1 1⁄16	1.10	1⅛	1.41	1 7⁄16	2.14	2⅛	2.15	2⅛	2.15	2⅛

Continued on next page


PureFlow Press Tee Polymer – Model V5618, continued

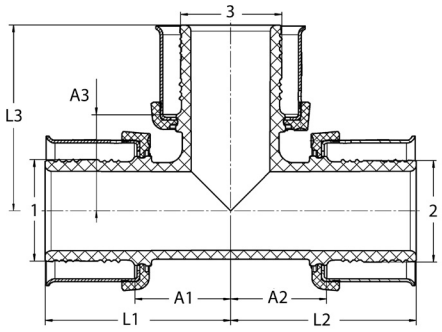

Continued from previous page


Part No.	Size (in)	A1 (in)		A2 (in)		A3 (in)		L1 (in)		L2 (in)		L3 (in)	
	1 2 3	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
49987	2 x 1½ x 1¼	1.25	1¼	1.10	1⅛	1.50	1½	2.33	2⁵⁄₁₆	2.15	2⅛	2.50	2½
49988	2 x 1½ x 1½	1.25	1¼	1.21	1³⁄₁₆	1.46	1⁷⁄₁₆	2.33	2⁵⁄₁₆	2.26	2¼	2.50	2½
49993	2 x 2 x ½	0.98	1	0.98	1	1.46	1⁷⁄₁₆	2.06	2¹⁄₁₆	2.06	2¹⁄₁₆	2.05	2¹⁄₁₆
49994	2 x 2 x ¾	0.98	1	0.98	1	1.50	1½	2.06	2¹⁄₁₆	2.06	2¹⁄₁₆	2.05	2¹⁄₁₆
49995	2 x 2 x 1	1.10	1⅛	1.10	1⅛	1.53	1½	2.17	2³⁄₁₆	2.17	2³⁄₁₆	2.26	2¼
49997	2 x 2 x 1¼	1.25	1¼	1.25	1¼	1.50	1½	2.33	2⁵⁄₁₆	2.33	2⁵⁄₁₆	2.54	2⁹⁄₁₆
49998	2 x 2 x 1½	1.37	1⅜	1.37	1⅜	1.46	1⁷⁄₁₆	2.45	2⁷⁄₁₆	2.45	2⁷⁄₁₆	2.50	2½
49590	2 x 2 x 2	1.65	1⅝	1.65	1⅝	1.65	1⅝	2.72	2¾	2.72	2¾	2.72	2¾

PureFlow Press Tee Arrestor Zero Lead Brass P x P – Model 2894ZL

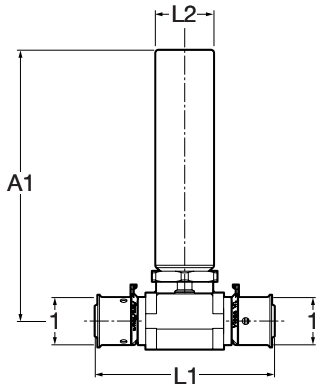


Part No.	Size (in)	A1 (in)		L1 (in)		L2 (in)	
	1 1	Dec	Frac	Dec	Frac	Dec	Frac
97114	½ x ½	3.90	3⅞	2.59	2⁹⁄₁₆	0.84	¹³⁄₁₆

PureFlow Press Tee Bronze – Model 2818NG

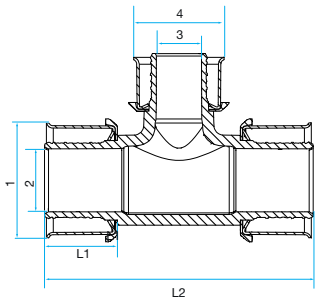


Part No.	Size (in)			A1 (in)		A2 (in)		A3 (in)		A4 (in)		L1 (in)		L2 (in)	
	1	2	3	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
84030	⅝ x ⅝ x ⅝			0.63	⅝	0.46	7⁄16	0.46	7⁄16	0.63	⅝	0.61	⅝	2.18	2 3⁄16

PureFlow Press Adapter Zero Lead Bronze P x MPT – Model 2811ZL

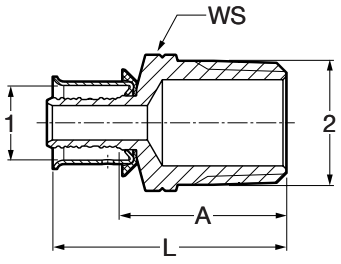


Part No.	Size (in)		A (in)		L (in)		WS (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
90506	⅜ x ½ MPT		1.14	1⅛	1.63	1⅝	0.87	⅞
90521	½ x ½ MPT		1.10	1⅛	1.59	1 9⁄16	0.87	⅞
90526	½ x ¾ MPT		1.15	1⅛	1.64	1⅝	1.06	1 1⁄16
90542	¾ x ½ MPT		1.10	1⅛	1.59	1 9⁄16	0.87	⅞
90541	¾ x ¾ MPT		1.15	1⅛	1.64	1⅝	1.06	1 1⁄16
90546	¾ x 1 MPT		1.41	1 7⁄16	1.91	1 15⁄16	1.34	1 5⁄16
90562	¾ x 1¼ MPT		1.65	1⅝	2.10	2⅛	1.73	1¾
90556	1 x ¾ MPT		1.18	1 3⁄16	1.80	1 13⁄16	1.06	1 1⁄16
90561	1 x 1 MPT		1.41	1 7⁄16	2.03	2 1⁄16	1.34	1 5⁄16
90566	1 x 1¼ MPT		1.60	1⅝	2.22	2¼	1.73	1¾
90571	1¼ x 1¼ MPT		1.63	1⅝	2.50	2½	1.73	1¾
90581	1½ x 1½ MPT		1.79	1 13⁄16	2.66	2 11⁄16	1.97	2
90591	2 x 2 MPT		2.08	2 1⁄16	3.13	3⅛	2.44	2 7⁄16

PureFlow Press Adapter Zero Lead Bronze P x FPT – Model 2812ZL

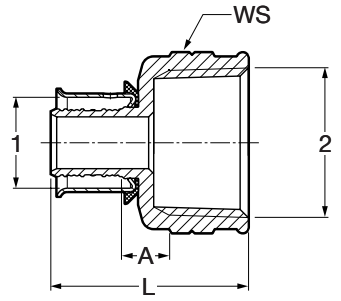


Part No.	Size (in)		A (in)		L (in)		WS (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
91520	½ x ½ FPT		0.35	⅜	1.38	1⅜	0.98	1
91525	½ x ¾ FPT		0.37	⅜	1.42	1 7⁄16	1.20	1 3⁄16
91541	¾ x ½ FPT		0.31	5⁄16	1.34	1 5⁄16	0.98	1
91540	¾ x ¾ FPT		0.37	⅜	1.42	1 7⁄16	1.20	1 3⁄16
91545	1 x ¾ FPT		0.40	⅜	1.58	1 9⁄16	1.20	1 3⁄16
91560	1 x 1 FPT		0.41	7⁄16	1.69	1 11⁄16	1.48	1½
91570	1¼ x 1¼ FPT		0.58	9⁄16	2.13	2⅛	1.85	1⅞
91580	1½ x 1½ FPT		0.60	⅝	2.15	2⅛	2.09	2 1⁄16
91590	2 x 2 FPT		0.62	⅝	2.36	2⅜	2.60	2⅝

PureFlow Press Adapter Zero Lead Bronze P x Copper – Model 2813.5ZL

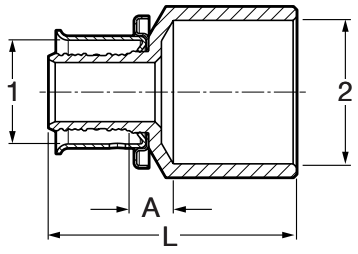

Part No.	Size (in) 1 2	A (in) Dec	A (in) Frac	L (in) Dec	L (in) Frac
92006	⅜ x ½	0.29	5/16	1.28	1¼
92021	½ x ½	0.23	¼	1.24	1¼
92026	½ x ¾	0.27	¼	1.52	1½
92036	¾ x ½	0.20	3/16	1.18	1 3/16
92041	¾ x ¾	0.27	¼	1.52	1½
92045	¾ x 1	0.37	⅜	1.77	1¾
92060	1 x 1	0.34	5/16	1.89	1⅞
92070	1¼ x 1¼	0.43	7/16	2.28	2¼
92080	1½ x 1½	0.45	7/16	2.44	2 7/16
92090	2 x 2	0.43	7/16	2.60	2⅝


PureFlow Press Adapter Zero Lead Bronze P x FTG – Model 2813.1ZL

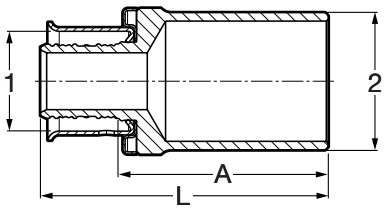

Part No.	Size (in) 1 2	A (in) Dec	A (in) Frac	L (in) Dec	L (in) Frac
97520	½ x ½	1.26	1¼	1.77	1¾
97525	½ x ¾	1.34	1 5/16	1.83	1 13/16
97535	¾ x ½	1.33	1 5/16	1.83	1 13/16
97540	¾ x ¾	1.45	1 7/16	1.95	1 15/16
97545	¾ x 1	1.45	1 7/16	1.95	1 15/16
97560	1 x 1	1.51	1½	2.13	2⅛
97570	1¼ x 1¼	1.83	1 13/16	2.72	2¾
97580	1½ x 1½	2.21	2 3/16	3.07	3 1/16
97590*	2 x 2	2.36	2⅜	3.41	3 7/16

**For use with solder fittings only.*


PureFlow Press Adapter Zero Lead Bronze P x FTG – Model 2813.3ZL

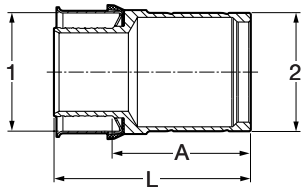

Part No.	Size (in) 1 2	A (in) Dec	A (in) Frac	L (in) Dec	L (in) Frac
97690*	2 x 2	2.50	2½	3.54	3 9/16


**For use with ProPress fittings only.*

PureFlow Press Adapter Zero Lead Bronze P x PB – Model 2813.2ZL

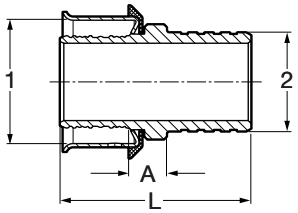


Part No.	Size (in) 1 2	A (in) Dec	A (in) Frac	L (in) Dec	L (in) Frac
97820	½ x ½	0.28	¼	1.38	1⅜
97840	¾ x ¾	0.28	¼	1.38	1⅜

PureFlow Press Adapter Zero Lead Bronze P x Flare – Model 2892ZL

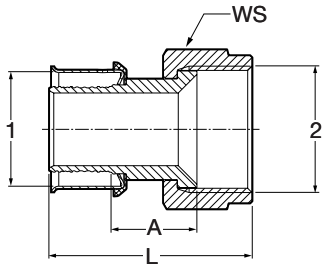


Part No.	Size (in)		A (in)		L (in)		WS (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
97140	¾ x ¾ Flare		0.67	11/16	1.71	1 11/16	1.50	1½
97160	1 x ¾ Flare		0.86	⅞	2.03	2 1/16	1.50	1½
97165	1 x 1 Flare		0.65	⅝	1.89	1⅞	1.80	1 13/16

PureFlow Press Tailpiece Zero Lead Bronze P x F BSP – Model 2893ZL

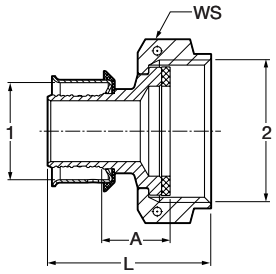


Part No.	Size (in)		A (in)		L (in)		WS (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
96140	¾ x 1		0.63	⅝	1.50	1½	1.46	1 7/16
96160	1 x 1		0.84	13/16	1.83	1 13/16	1.46	1 7/16
96165	1 x 1¼		0.78	¾	1.80	1 13/16	1.81	1 13/16

PureFlow Press Coupling Zero Lead Bronze P x P – Model 2815ZL

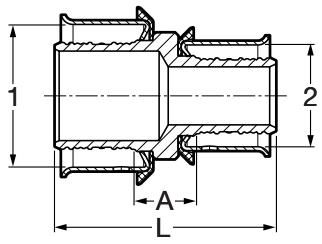


Part No.	Size (in)		A (in)		L (in)	
	1	2	Dec	Frac	Dec	Frac
93001	5/16 x 5/16		0.40	⅜	1.38	1⅜
93000	⅜ x ⅜		0.40	⅜	1.38	1⅜
93005	½ x ⅜		0.40	⅜	1.38	1⅜
93020	½ x ½		0.40	⅜	1.38	1⅜
93050	½ x ¾		0.40	⅜	1.38	1⅜
93030	⅝ x ⅝		0.40	⅜	1.38	1⅜
93040	¾ x ¾		0.40	⅜	1.38	1⅜
93055	¾ x 1		0.46	7/16	1.58	1 9/16
93071	¾ x 1¼		0.51	½	1.87	1⅞
93072	¾ x 1½		0.51	½	1.87	1⅞
93060	1 x 1		0.46	7/16	1.69	1 11/16
93065	1 x 1¼		0.54	9/16	2.03	2 1/16
93073	1 x 1½		0.54	9/16	2.03	2 1/16
93070	1¼ x 1¼		0.67	11/16	2.40	2⅜
93075	1¼ x 1½		0.59	9/16	2.32	2 5/16
93080	1½ x 1½		0.67	11/16	2.40	2⅜
93090	2 x 2		0.66	11/16	2.76	2¾
93091	2 x 1½		0.69	11/16	2.60	2⅝

PureFlow Press Coupling Polymer – Model V5615

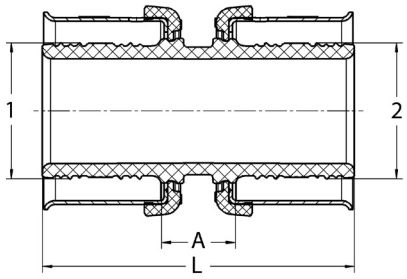


Part No.	Size (in)	A (in)		L (in)	
	1 2	Dec	Frac	Dec	Frac
49402	⅜ x ⅜	0.47	½	1.66	1 11/16
49342	½ x ⅜	0.42	7/16	1.61	1 5/8
49403	½ x ½	0.47	½	1.66	1 11/16
49404	¾ x ¾	0.47	½	1.66	1 11/16
49343	¾ x ½	0.43	7/16	1.62	1 5/8
49354	1 x ¾	0.47	½	1.82	1 13/16
49405	1 x 1	0.47	½	1.98	2
49347	1¼ x ¾	0.65	5/8	2.34	2 5/16
49357	1¼ x 1	0.48	½	2.33	2 5/16
49407	1¼ x 1¼	0.51	½	2.69	2 11/16
49348	1½ x ¾	0.69	11/16	2.37	2⅜
49358	1½ x 1	0.62	5/8	2.47	2½
49378	1½ x 1¼	0.50	½	2.69	2 11/16
49408	1½ x 1½	0.51	½	2.69	2 11/16
49398	2 x 1½	1.05	1 1/16	3.16	3 3/16
49409	2 x 2	1.02	1 1/16	3.16	3 3/16

PureFlow Press Test Plug Polymer – Model V5656

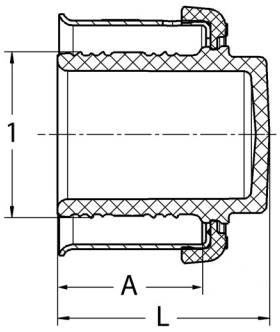


Part No.	Size (in)	A (in)		L (in)	
	1	Dec	Frac	Dec	Frac
49722	⅜	0.60	5/8	0.95	15/16
49723	½	0.60	5/8	0.95	15/16
49744	¾	0.60	5/8	0.95	15/16
49765	1	0.75	¾	1.10	1⅛
49770	1¼	1.10	1⅛	1.46	1 7/16
49780	1½	1.10	1⅛	1.46	1 7/16
49790	2	1.07	1 1/16	1.93	1 15/16

PureFlow Press Adapter Smart Connect Technology Zero Lead Bronze P x P – Model 2813PZL

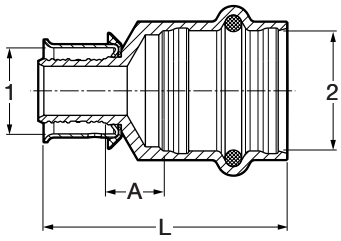


Part No.	Size (in)	A (in)		L (in)	
	1 2	Dec	Frac	Dec	Frac
99620	½ x ½	0.29	5/16	1.61	1 5/8
99626	½ x ¾	0.43	7/16	1.83	1 13/16
99630	¾ x ½	0.23	¼	1.56	1 9/16
99640	¾ x ¾	0.33	5/16	1.73	1¾
99645	1 x ¾	0.35	⅜	1.87	1⅞
99660	1 x 1	0.45	7/16	1.97	2
99665	1¼ x 1	0.49	½	2.26	2¼
99670	1¼ x 1¼	0.49	½	2.38	2⅜
99675	1½ x 1	0.59	9/16	2.36	2⅜
99680	1½ x 1½	0.59	9/16	2.87	2⅞
99685	2 x 1	0.73	¾	2.68	2 11/16
99690	2 x 2	0.55	9/16	2.99	3

PureFlow Press Adapter Bronze P x MPT – Model 2811NG

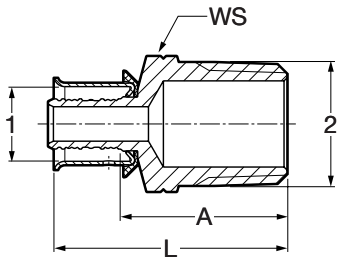


Part No.	Size (in)		A (in)		L (in)		WS (in)	
	1	2	Dec	Frac	Dec	Frac	Dec	Frac
80527	⅝ x ½	MPT	1.10	1⅛	1.59	1⁹⁄₁₆	0.87	⅞
80531	⅝ x ¾	MPT	1.15	1⅛	1.64	1⅝	1.06	1¹⁄₁₆

PureFlow Press Adapter Smart Connect Technology Bronze P x P – Model 2813PNG

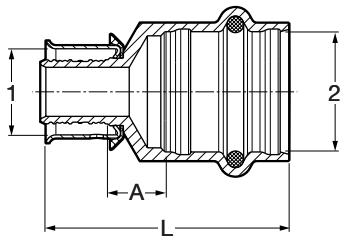


Part No.	Size (in)		A (in)		L (in)	
	1	2	Dec	Frac	Dec	Frac
69627	⅝ x	½	0.23	¼	1.56	1⁹⁄₁₆
69628	⅝ x	¾	0.33	⁵⁄₁₆	1.73	1¾

PureFlow Press Adapter Bronze P x Copper – Model 2813.5NG

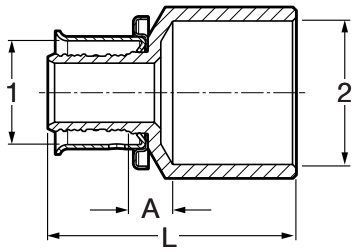


Part No.	Size (in)		A (in)		L (in)	
	1	2	Dec	Frac	Dec	Frac
82031	⅝ x	¾	0.27	¼	1.52	1½

PureFlow Press Adapter Bronze – Model 2813.1NG

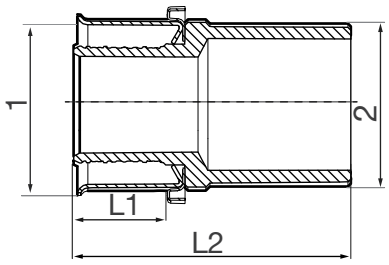


Part No.	Size (in)		L1 (in)		L2 (in)	
	1	2	Dec	Frac	Dec	Frac
87531	⅝ x	¾	12.6	12⅝	44.5	44½

PureFlow Press Multi–port Tee Polymer Flow Through – Model V5636

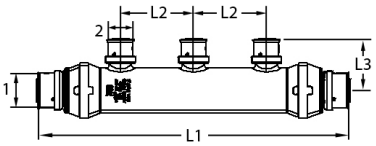


Part No	Size (in) 1	2	Outlets	L1 (in) Dec	L1 (in) Frac	L2 (in) Dec	L2 (in) Frac	L3 (in) Dec	L3 (in) Frac
49152	¾ x ½		2	6.58	6 9/16	2.00	2	1.42	1 7/16
49153	¾ x ½		3	8.58	8 9/16	2.00	2	1.42	1 7/16
49054	¾ x ½		4	10.58	10 9/16	2.00	2	1.42	1 7/16
49254	1 x ¾ x ½		4	10.72	10¾	2.00	2	1.42	1 7/16
49256	1 x ½		6	14.85	14⅞	2.00	2	1.42	1 7/16
49258	1 x ½		8	18.85	18⅞	2.00	2	1.42	1 7/16

PureFlow Press Multi–port Tee Polymer Closed – Model V5636.1

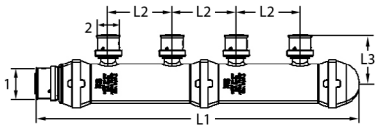


Part No	Size (in) 1	2	Outlets	L1 (in) Dec	L1 (in) Frac	L2 (in) Dec	L2 (in) Frac	L3 (in) Dec	L3 (in) Frac
49004	¾ x ½		4	10.14	10⅛	2.00	2	1.42	1 7/16
49206	1 x ½		6	14.27	14¼	2.00	2	1.42	1 7/16
49208	1 x ½		8	18.28	18¼	2.00	2	1.42	1 7/16

PureFlow Press Tub 90° Elbow Zero Lead Brazed Copper – Model 2820.0ZL

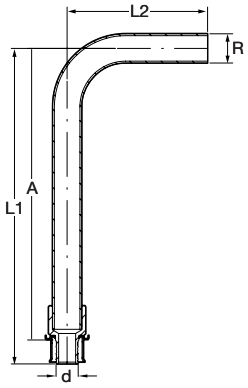


Part No.	Size (in) d	R	A (in) Dec	A (in) Frac	L1 (in) Dec	L1 (in) Frac	L2 (in) Dec	L2 (in) Frac
92221	½ x ½ Copper		6.22	6¼	6.74	6¾	3.00	3

PureFlow Press 90° Stub–out Brazed Copper P x FTG – Model 2820.1ZL

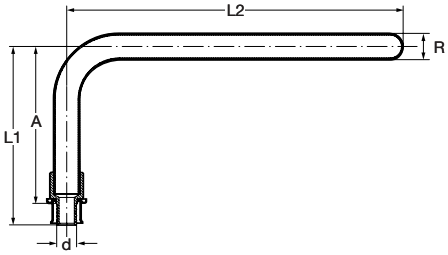


Part No.	Size (in) d	R	A (in) Dec	A (in) Frac	L1 (in) Dec	L1 (in) Frac	L2 (in) Dec	L2 (in) Frac
92406	⅜ x ½ Copper		3.76	3¾	4.28	4¼	8.00	8
92421	½ x ½ Copper		3.72	3¾	4.24	4¼	8.00	8
92441	¾ x ¾ Copper		4.77	4¾	4.24	4¼	8.00	8

PureFlow Press 90° Stub–out Brazed Copper P x FTG – Model 2820.4ZL

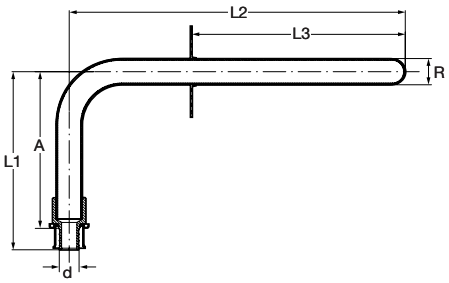


Part No.	Size (in)	A (in)		L1 (in)		L2 (in)		L3 (in)	
	d R	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
92305	⅜ x ½ Copper	3.76	3¾	4.28	4¼	8.00	8	6.00	6
92321	½ x ½ Copper	3.72	3¾	4.24	4¼	8.00	8	6.00	6

PureFlow Press Stub–out Brazed Copper P x FTG – Model 2820.2ZL




Part No.	Size (in)	A (in)		L1 (in)	
	d R	Dec	Frac	Dec	Frac
92609	½ x ½ Copper	8.00	8	8.74	8¾
92616	½ x ½ Copper	15.00	15	15.74	15¾

PureFlow Press Lav Adapter Polymer P x Lav – Model V5613.3

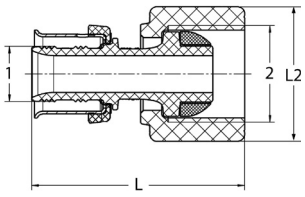


Part No.	Size (in)	L (in)		L2 (in)	
	1 2	Dec	Frac	Dec	Frac
49324	⅜ x ½ Lav	1.82	1 13⁄16	1.15	1⅛
49333	½ x ½ Lav	1.82	1 13⁄16	1.15	1⅛
49344	¾ x ¾ Lav	1.78	1¾	1.15	1⅛

PureFlow Press Adapter Zero Lead Bronze P x CTS – Model 2895ZL

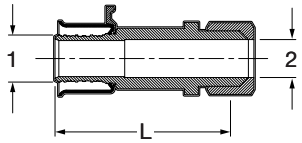


Part No.	Size (in)	L (in)	
	1 2	Dec	Frac
97112	⅜ x ¼ CTS (⅜ OD)	1.77	1¾
97113	½ x ¼ CTS (⅜ OD)	1.77	1¾

PureFlow Press Closet Adapter Polymer P x Closet – Model V5613.4

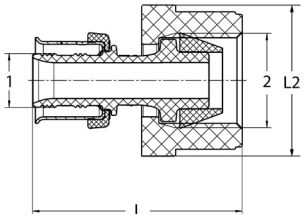

Part No.	Size (in)	L (in)		L2 (in)	
	1 2	Dec	Frac	Dec	Frac
49223	⅜ x ½ Closet	1.84	1 13⁄16	1.3	1 5⁄16
49233	½ x ½ Closet	1.84	1 13⁄16	1.3	1 5⁄16


PureFlow Press Outlet Box Zero Lead for Washing Machine, Ice Maker – Models 2872.0ZL / 2872.7ZL

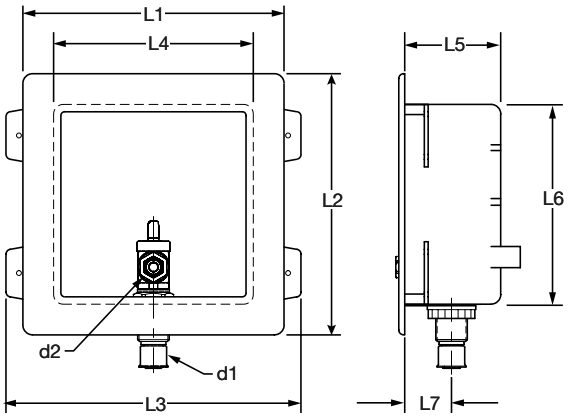

Part No.	Size (in)		L1 (in)		L2 (in)		L3 (in)		L4 (in)		L5 (in)		L6 (in)		L7 (in)	
No.	d1	d2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
98000	½ PEX x ¼ O.D.		6.80	6 13/16	6.80	6 13/16	7.68	7 11/16	5.20	5 3/16	2.50	2½	5.20	5 3/16	1.22	1¼
97220*	½ PEX x ¼ O.D.		6.80	6 13/16	6.80	6 13/16	7.68	7 11/16	5.20	5 3/16	2.50	2½	5.20	5 3/16	1.22	1¼

** with hammer arrestor*


PureFlow Press Outlet Box Zero Lead for Washing Machine, Ice Maker – Models 2872.1US / 2872.6ZL

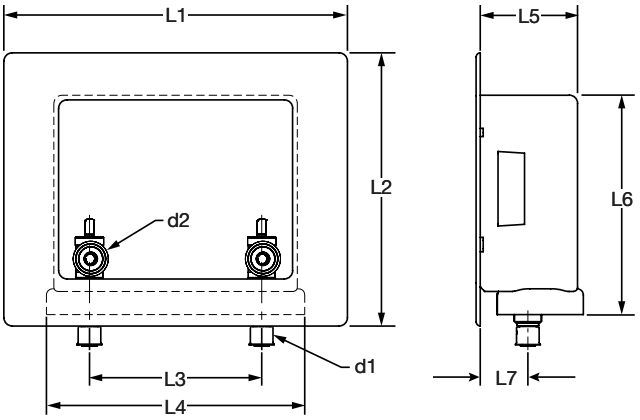

Part No.	Size (in)		L1 (in)		L2 (in)		L3 (in)		L4 (in)		L5 (in)		L6 (in)		L7 (in)	
No.	d1	d2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
97001	½ PEX x ¾ O.D.		10.40	10 3/8	8.30	8 5/16	5.20	5 3/16	7.40	7 3/8	2.90	2 7/8	6.60	6 5/8	1.43	1 7/16
97212*	½ PEX x ¾ O.D.		10.40	10 3/8	8.30	8 5/16	5.20	5 3/16	7.40	7 3/8	2.90	2 7/8	6.60	6 5/8	1.43	1 7/16

** with hammer arrestor*


PureFlow Press Fire–Rated Outlet Box Zero Lead for Washing Machine, Ice Maker – Models 2872.2 / 2872.6

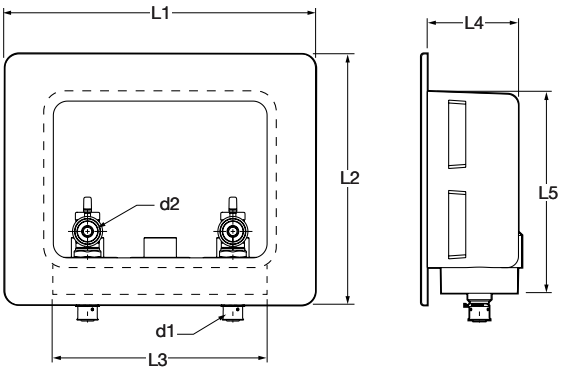

Part No.	Size (in) d1	d2	Face Plate L1 (in) Dec	Frac	L2 (in) Dec	Frac	L3 (in) Dec	Frac	L4 (in) Dec	Frac	L5 (in) Dec	Frac
97006	½ PEX x ¼ O.D.		10.90	10⅞	8.80	8 13⁄16	8.20	8 3⁄16	3.40	3⅜	7.10	7⅛
97008*	½ PEX x ¼ O.D.		10.90	10⅞	8.80	8 13⁄16	8.20	8 3⁄16	3.40	3⅜	7.10	7⅛

** with hammer arrestor*


PureFlow Press Fire–Rated Outlet Box Zero Lead for Washing Machine, Ice Maker – Models 2872.5 / 2872.3

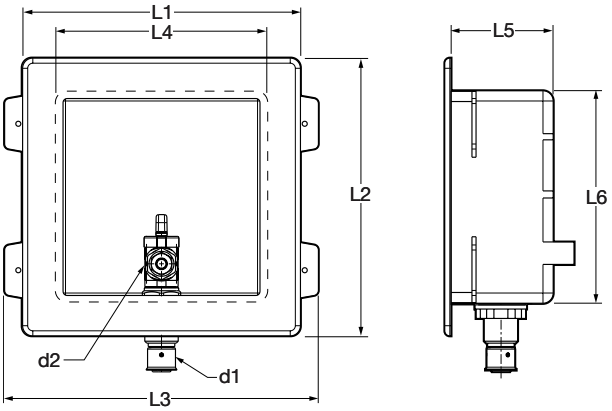

Part No.	Size (in) d1	d2	L1 (in) Dec	Frac	L2 (in) Dec	Frac	L3 (in) Dec	Frac	L4 (in) Dec	Frac	L5 (in) Dec	Frac	L6 (in) Dec	Frac
98001	½ PEX x ¾ O.D.		5.25	5¼	7.29	7 5⁄16	6.90	6⅞	3.90	3⅞	2.83	2 13⁄16	5.69	5 11⁄16
97007*	½ PEX x ¾ O.D.		5.25	5¼	7.29	7 5⁄16	6.90	6⅞	3.90	3⅞	2.83	2 13⁄16	5.69	5 11⁄16


** with hammer arrestor*

PureFlow Press Ball Valve Zero Lead Brass P x P – Model 2870ZL

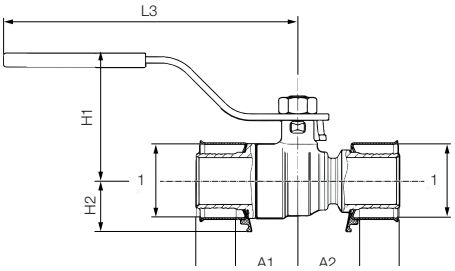


Part No.	Size (in)	L1 (in)		L2 (in)		L3 (in)		L4 (in)	
	d	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
98200	1	3.15	3 1/8	1.89	1 7/8	1.99	2	4.57	4 9/16
98201	1 1/4	3.60	3 5/8	1.75	1 3/4	2.10	2 1/8	4.57	4 9/16
98202	1 1/2	3.88	3 7/8	2.15	2 1/8	2.47	2 1/2	5.77	5 3/4
98203	2	4.57	4 9/16	2.44	2 7/16	2.69	2 11/16	5.77	5 3/4

Viega PureFlow PureFlow Press Ball Valve – Model 2875ZL

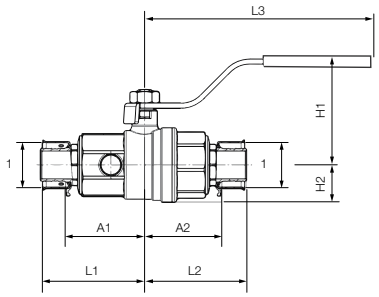


Part No.	Size (in)	H1 (in)		H2 (in)		L1 (in)		L2 (in)		L3 (in)		A1 (in)		A2 (in)		Cv (US
	1	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	gal/min)
87910	1/2	2.05	2 1/16	0.63	5/8	1.97	2	1.93	1 15/16	4.61	4 5/8	1.50	1 1/2	1.46	1 7/16	4.38
87915	3/4	2.20	2 3/16	0.75	3/4	2.09	2 1/16	2.05	2 1/16	4.61	4 5/8	1.57	1 9/16	1.57	1 9/16	12.4

Viega PureFlow Press x ProPress Ball Valve – Model 2882.1ZL

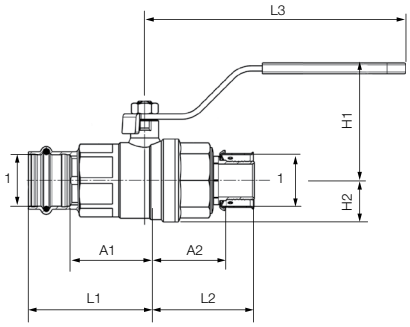


Part	Size (in)	H1 (in)		H2 (in)		L1 (in)		L2 (in)		L3 (in)		A1 (in)		A2 (in)		Cv (US
No.	1	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac	gal/min)
87855	1/2	2.05	2 1/16	0.63	5/8	1.97	2	1.93	1 15/16	4.61	4 5/8	1.14	1 1/8	1.46	1 7/16	8.01
87860	3/4	2.17	2 3/16	0.75	3/4	2.24	2 1/4	2.05	2 1/16	4.61	4 5/8	1.34	1 5/16	1.54	1 9/16	16
87865	1	2.60	2 5/8	0.91	15/16	2.56	2 9/16	2.44	2 7/16	5.75	5 3/4	1.65	1 5/8	1.81	1 13/16	27.2
87870	1 1/4	2.80	2 13/16	1.18	1 3/16	2.83	2 13/16	2.95	2 15/16	5.79	5 13/16	1.81	1 13/16	2.09	2 1/16	46.5
87875	1 1/2	3.15	3 1/8	1.42	1 7/16	3.35	3 3/8	3.31	3 5/16	6.14	6 1/8	1.93	1 15/16	2.44	2 7/16	57.1
87880	2	3.47	3 1/2	1.73	1 3/4	3.82	3 13/16	3.86	3 7/8	6.14	6 1/8	2.24	2 1/4	2.80	2 13/16	105

PureFlow Press Ball Valve Zero Lead Brass P x P – Model 2842.2ZL

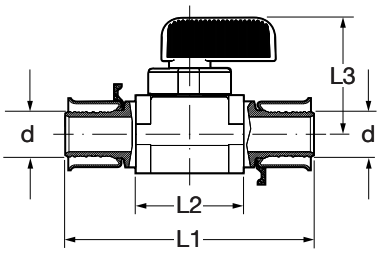


Part No.	Size (in)	L1 (in)		L2 (in)		L3 (in)	
	d	Dec	Frac	Dec	Frac	Dec	Frac
94500	⅜	2.62	2⅝	1.20	1³⁄₁₆	1.20	1³⁄₁₆
94521	½	2.59	2⁹⁄₁₆	1.20	1³⁄₁₆	1.20	1³⁄₁₆
94541	¾	2.72	2¾	1.30	1⁵⁄₁₆	1.30	1⁵⁄₁₆

ProPress Valve Zero Lead Brass P x FTG – Model 2842.1ZL

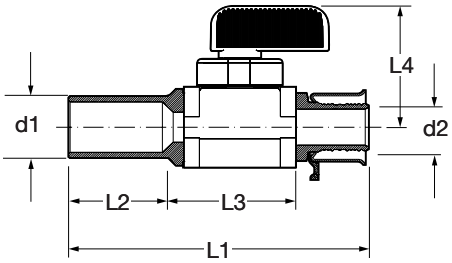


Part No.	Size (in)	L1 (in)		L2 (in)		L3 (in)		L4 (in)	
	d1 d2	Dec	Frac	Dec	Frac	Dec	Frac	Dec	Frac
95002	½ x ½ FTG	3.01	3¹⁄₁₆	1.20	1³⁄₁₆	1.10	1⅛	1.20	1³⁄₁₆

PureFlow Press Stop Valve Straight Zero Lead Chrome Plated Brass P x CTS ¼ Turn – Model 2842.3ZL

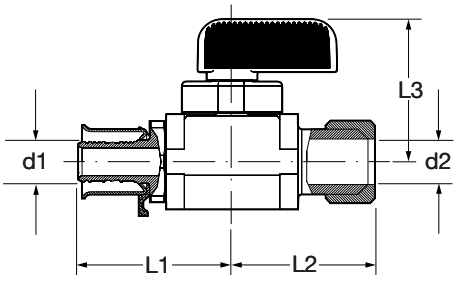


Part No.	Size (in)	L1 (in)		L2 (in)		L3 (in)	
	d1 d2	Dec	Frac	Dec	Frac	Dec	Frac
94023	⅜ x ¼ CTS (⅜ OD) Comp	2.53	2½	1.20	1³⁄₁₆	1.20	1³⁄₁₆
94031	½ x ¼ CTS (⅜ OD) Comp	2.51	2½	1.20	1³⁄₁₆	1.20	1³⁄₁₆

PureFlow Press Stop Valve Angled Zero Lead Chrome Plated Brass P x CTS ¼ Turn – Model 2842.4ZL

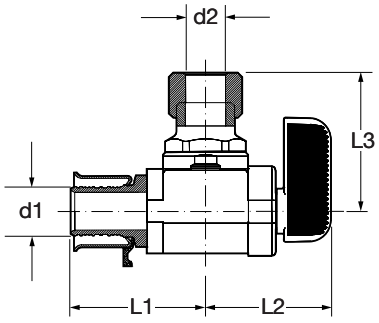


Part No.	Size (in)	L1 (in)		L2 (in)		L3 (in)	
	d1 d2	Dec	Frac	Dec	Frac	Dec	Frac
93515	⅜ x ¼ CTS (⅜ OD) Comp	2.51	2½	1.03	1¹⁄₁₆	1.20	1³⁄₁₆
93511	½ x ¼ CTS (⅜ OD) Comp	2.51	2½	1.03	1¹⁄₁₆	1.20	1³⁄₁₆

PureFlow Press Wall Hydrant Zero Lead Chrome Plated Brass – Model 2888.0ZL

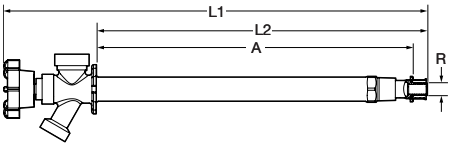


Part No.	R (in)	A (in)		L1 (in)		L2 (in)	
		Dec	Frac	Dec	Frac	Dec	Frac
97120	½	11.7	11 11/16	15.6	15 9/16	12.2	12 3/16
97121	¾	11.8	11 3/4	15.7	15 11/16	12.3	12 5/16

Shower Valve – Model 2842.5

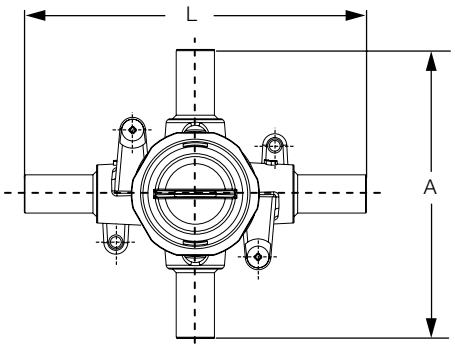

Part No.	Stub Out (in)	A (in)		L (in)	
		Dec	Frac	Dec	Frac
93516	½	4.75	4 3/4	5.625	5 5/8

Shower Valve – Model 2842.6

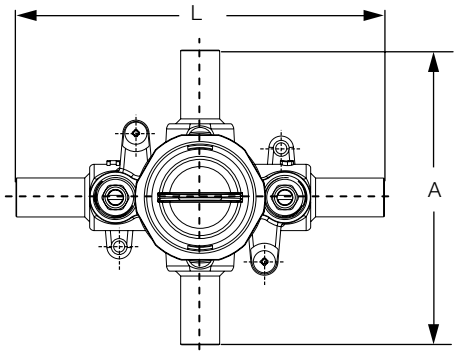

Part No.	Stub Out (in)	A (in)		L (in)	
		Dec	Frac	Dec	Frac
93517	½	4.75	4 3/4	5.875	5 7/8